

Bulletin
 Number 5017

Issue 2

Date 5.4.49

Sheet 1 of 2 Sheets

MODELS AFFECTED
 1948-49 "60" AND "75"
 LAND-ROVER

UNIT AFFECTED
BRAKES

COMPLAINT

SUBJECT

BRAKE LININGS

A variety of brake linings have been used on 1948-49 cars and Land-Rover ; the service and spare parts procedure to be followed is detailed below :—

"60" and "75"

Brake linings have been manufactured from three different materials as shown in the table :—

Type of lining	Part Number	Lining identification	Brake unit assembly identification
Ferodo MR19	---	Three blue marks along one edge towards one end	None
Ferodo MR41	---	Five blue marks equally spaced along one edge	None
DON BS5	Lining 231445 Shoe assembly— 231441/2/3/4	One red mark in the centre of one edge	Red spot on rear of anchor plate.

Our Spares Department will supply only DON BS5 linings against all orders for 1948-49 "60" and "75" models. Any stocks of MR19 or MR41 linings in your possession should be used up on 1947 and earlier models under Part No. 07230.

Whenever it becomes necessary to equip a car with linings of different material from those originally fitted (which point can be ascertained from the identification markings on the brake anchor plates), it is essential that a complete vehicle set of eight linings, or if this is not possible, at least a complete axle set of four linings, be fitted. Poor and uneven braking is liable to result if a mixed set of linings is employed.

This sheet replaces that already in your file which bears the SAME bulletin and sheet numbers, but of a LOWER issue number. The old copy should be removed and destroyed.

Bulletin
 Number 5017

Issue 2

Date 5.4.49

Sheet 2 of 2 Sheets

MODELS AFFECTED
 1948-49 "60" AND "75"
 LAND-ROVER

UNIT AFFECTED
BRAKES

COMPLAINT

SUBJECT

BRAKE LININGS

"Land-Rover" wheel brakes.

Brake linings have been manufactured from two different materials as shown in the table :—

Type of lining	Part number	Lining identification	Brake unit assembly identification
Ferodo MR41	—	Five blue marks equally spaced along one edge	None
DON BS5	Lining 231438 Shoe assembly— 231436/7	One red mark in the centre of one edge	Red spot on rear of anchor plate

Only DON BS5 linings will be supplied as replacements for all vehicles, when stocks of Ferodo MR41 linings are exhausted.

Whenever it becomes necessary to equip a Land-Rover with linings of different material from those originally fitted (which point can be ascertained from the identification markings on the brake anchor plates), it is essential that a complete vehicle set of eight linings, or if this is not possible, at least a complete axle set of four linings, be fitted. Poor and uneven braking is liable to result if a mixed set of linings is employed.

Land-Rover transmission brake.

Brake linings for this brake are made only from Ferodo MR19 material and supplied under Part No. 219007 for the lining only and 219005 for the brake shoe assembly.

This sheet replaces that already in your file which bears the SAME bulletin and sheet numbers, but of a LOWER issue number. The old copy should be removed and destroyed.