

THE ROVER COMPANY LIMITED
S E R V I C E D E P A R T M E N T

SOLIHULL, BIRMINGHAM, England
Telephone Nos.: Sheldon 2461, 2613
Telegrams: Rovrepair, Solihull

Rover Service News Letter No. 43

April 30th, 1954

TO ALL DISTRIBUTORS AND DEALERS

GENERAL

**Item 35 IMPORTANT.
MONTHLY STOCK
ORDER, JULY, 1954**

Distributors are reminded that, as in earlier years, we do not require a Monthly Stock Order for July, the requirements for which should be included in the June Monthly Stock Order.

It will be recalled that last year we accepted a Monthly Stock Order for July, and this was because we were of the opinion that they could be successfully handled, despite the fact that our annual stocktaking occurs at the end of that month. Subsequent events, however, proved us to be wrong, and many of the July orders were not only themselves delayed but both August and September were also seriously affected. So once again we revert to the old arrangement.

Please do not send us a Stock Order for July.

**Item 36 CARBURETTER
1940-47 14 and 16 h.p.**

Please note that we can now accept Carburetters, Part Nos. 07994 and 08943, used on the 1940-47 14 and 16 h.p. models, in part exchange for the replacement Carburetter, Part No. 262081.

The exchange price is £9 9s. 9d. retail.

**Item 37 ROVER BODY REPAIR
KIT**

When ordering Birmabright welding rod and Filzall rod for the Rover Body Repair Kit will you please state the number of sticks required in each case? For your reference the original kit contains:—

Birmabright welding rod .080 in. by 23 in. long, Part No. 13605. 100 sticks.

Birmabright welding rod .125 in. by 23 in. long, Part No. 13606. 50 sticks.

“Filzall” rod, Part No. 13608. 100 sticks.

Will Overseas Distributors and Dealers also state the voltage of their electric supply so that a suitable electric paddle can be supplied in the kit?

For replacement purposes two types of Electric paddle are available, 110 volt and 240 volt, these are obtainable under the Part Nos. detailed below:—

Electric paddle 110 v.	313998
Element for paddle 110 v.	313999
Electric paddle 240 v.	314005
Element for paddle 240 v.	314006

Item 38 FUEL SYSTEM
 1950-53 "75"
 1954 "60", "75", "90"

One or two cases have been reported of the felt in the petrol filler neck becoming blocked. This creates a vacuum in the petrol tank and gives the impression of petrol pump failure. The Felt, Part No. 262108, should be checked occasionally and renewed if necessary.


Please bring the above to the notice of all Service Personnel.

ROVER "60", "75", and "90"

Item 39 SPARE WHEEL HOUSING
 1954 "60", "75", "90"

The housing for the spare wheel on the 1954 "60" "75" and "90" has been modified by fitting a Safety Catch for the spare wheel, Part No. 246365, from Cars numbered "60": 43301228, 43330015, 43360011, 43630001 and 43660009 onwards. "75": 44302210, 44330530, 44360447, 44730001 and 44760017 onwards. "90": 45300908, 45330325, 45360792, 45830001 and 45860017 onwards.

Any earlier 1954 "60", "75" and "90" or 1952-53 "75" Car can be modified by fitting the Safety catch, using catch as a template, as shown in the sketch below. A complete kit of parts for this modification can be obtained from our Spares Dept. under Part No. 263156.

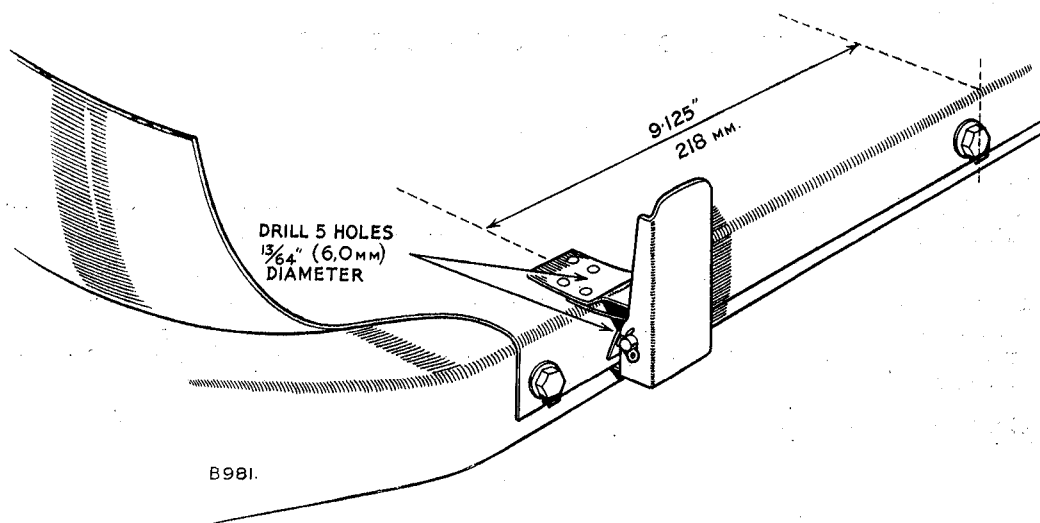

Position of safety catch on spare wheel housing.

Item 40 WINDSCREEN WASHER A larger capacity reservoir for the Windscreen Washer has been introduced 1954 "75" and "90" from Cars numbered:—

"75": 44302357, 44330601, 44300458, 44730001 and 44760017 onwards.
 "90": 45300908, 45330325, 45360792, 45830001 and 45860009 onwards.

The new parts detailed below, except the complete assembly, are not interchangeable with the earlier type.

Windscreen washer complete assembly	1	246269
Bracket for windscreen washer reservoir	1	246275
Windscreen washer reservoir and cap	1	246273
Windscreen washer pump and pipes	1	246274

All other items are common to both early and late type windscreen washers.